

WABCO	<u>Service Bulletin</u>		PROD GROUP NO	TRI	YEAR	CUR NO
			300			
		DATE 2/08/10	DOC CODE	SHEET 1 OF 1		
PRODUCT IDENTIFICATION 914 005 061 0	PRODUCT NAME Land Rover Piston Pump ERR3539			ORDER NO.		
DISTRIBUTION : File Copy. ----- ----- ----- -----			FOR INFORMATION :			

To minimise the possibility of failure due to contamination and oil starvation there are a number of actions that can be taken.

- 1 Ensure that the oil jet that is pointed towards the cam follower on the pump works correctly.
- 2 Before fitment of the new pump ensure that the engine is clean and that a new oil filter has been fitted. It is recommended that flushing oil is used to clean the engine.
- 3 Check the brake booster circuit to make sure that the pipe from the vacuum pump to the booster is intact and there are no issues with the booster, it is possible to suck contamination into the pump via the booster.



APPROVAL LEVEL	COMPILED	APPROVED	3	4
NAME	M. Pickard	A. Wilson		
DATE	2/8/2010	2/8/2010		
SIGNED				

-- APPROVAL LEVEL SEE DELEGATION OF AUTHORITY --
 -- NOTES FOR HANDLING OF THIS TEST REPORT SEE JED 418 --